

FORM  
6Rev  
05/18

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

401868452

Date Received:

12/10/2018

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name:

Tel:

COGCC contact:

Email:

API Number 05-123-18997-00

Well Name: MOTIS

Well Number: 44-7

Location: QtrQtr: SESE Section: 7 Township: 5N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 56633

Field Name: WATTENBERG

Field Number: 90750

☐ Notice of Intent to Abandon☒ Subsequent Report of Abandonment

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.408310

Longitude: -104.586940

GPS Data:

Date of Measurement: 08/21/2010

PDOP Reading: 1.7

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment:

☐ Dry☐ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☐ Yes☐ No

Estimated Depth:

Fish in Hole:

☐ Yes☐ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☐ No

If yes, explain details below

Details:

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6844	6854	11/09/2018	B PLUG CEMENT TOP	6508
NIOBRARA	6558	6744	11/09/2018	B PLUG CEMENT TOP	6508

Total: 2 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	368	200	368	0	VISU
1ST	7+7/8	4+1/2	11.6	6,997	160	6,997	5,990	CBL
S.C. 1.1				5,419	553	5,419	0	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6508 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 1600 ft. to 990 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 45 sacks half in. half out surface casing from 568 ft. to 0 ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: 11/12/2018  
of \_\_\_\_\_

\*Wireline Contractor: C&J Energy Services \*Cementing Contractor: C&J Energy Services

Type of Cement and Additives Used: Type III 14.8 PPG Portland Cement

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

#### Technical Detail/Comments:

Motis 44-7 (05-123-18997)/Plugging Procedure  
Producing Formation: Codell: 6844'-6854' Niobrara: 6558'-6744'  
Upper Pierre Aquifer: 340'-1328'  
TD: 7031' PBD: 6957.4'  
Surface Casing: 8 5/8" 24# @ 368' w/ 200 sxs cmt  
Production Casing: 4 1/2" 11.6# @ 6997' w/ 160 sxs cmt (TOC @ 5990' - CBL).  
Annular Fill Cement @ 5419' w/ 553 sxs cmt ( TOC @ Surface - Well History).

#### Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6508'. Top with 2 sxs 15.8#/gal CI G cement.
4. Run CBL 6400' to Surface.
5. TIH w/ tubing to 1600'. RU cementing company. Mix and pump 40 sxs 14.8#/gal Type III cement down tubing. (Pierre coverage from 1600'-1100'). TOC at 990'.
6. Pickup tubing to 568'. Mix and pump 45 sxs 14.8#/gal Type III cement down tubing. Cement circulate to surface.
7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson  
Title: Reg Tech Date: 12/10/2018 Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved:

Date: 4/25/2019

**CONDITIONS OF APPROVAL, IF ANY:**

**COA Type**

**Description**

--	--

**Attachment Check List**

**Att Doc Num**

**Name**

401868452	WELL ABANDONMENT REPORT (SUBSEQUENT)
401868486	CEMENT JOB SUMMARY
401868493	WELLBORE DIAGRAM
402020888	FORM 6 SUBSEQUENT SUBMITTED

Total Attach: 4 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)