

QUARTERLY POND INSPECTION REPORT

Operator: Bowie Resources LLC
 Mine: Bowie No. 2 Mine - C-1996-083

Quarter: First 2024
 Inspection Date: 28-Mar-24

Pond Identification	B	C	D - Gob Pile	F - New Gob	J UTL East	K UTL West
Type of Pond	Sediment	Sediment	Sediment	Sediment	Sediment	Sediment

Status During Inspection:

Approximate Water Level	5942'	5990	5970'	5947'	5846'	5819
Sediment (% remaining)	90%	90%	80%	90%	80%	80%
Outflow (cfs)	0	0	0	0	0	0

Features	Problem	Problem	Problem	Problem	Problem	Problem
	Yes/No	Yes/No	Yes/No	Yes/No	Yes/No	Yes/No

Erosional

Rills & Gulleys	No	No	No	No	No	No
Inadequate Vegetation	No	No	No	No	No	No
Outlet Channel Erosion	No	No	No	No	No	No
Burrows	No	No	No	No	No	No
Other	No	No	No	No	No	No

Structural

Differential Settling	No	No	No	No	No	No
Cracks or Slides	No	No	No	No	No	No
Seepage	No	No	No	No	No	No
Other	No	No	No	No	No	No

Appurtenant Structures


Defective Spillways	No	No	No	No	No	No
Dewatering Devices Clogged	No	No	No	No	No	No
Faulty Gates, Etc.	No	No	No	No	No	No
Other	No	No	No	No	No	No

Additional Comments

Design depth measured from pond bottom to invert of emergency spillway:
 Pond B=10, C=10, D=10, J=10, K=3, F=10' TD
 Pond Bottom Elevations B=5942, C=5990, D=5970, J=5846, F=5944, K=5819
 Pond C was dry.
 Pond B was dry.
 Pond D was dry.
 Pond J is presumed dry, the bottom is covered with cattails. No water visible
 Pond K was dry.
 Pond F held about 2-3' of water.

SWMP components were inspected and found to be in good condition. No corrections necessary at this time.

Name of Inspector: Tamme Bishop

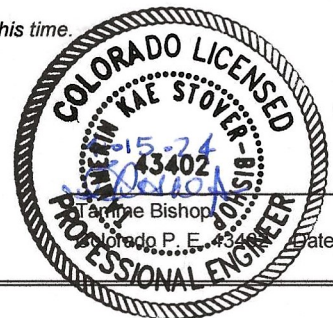

Tamme Bishop
 Colorado P. E. 43402 Date