


**COLORADO**Division of Reclamation,
Mining and Safety

Department of Natural Resources

**COLORADO DIVISION OF RECLAMATION, MINING AND SAFETY
MINERALS PROGRAM INSPECTION REPORT
PHONE: (303) 866-3567**

The Division of Reclamation, Mining and Safety has conducted an inspection of the mining operation noted below. This report documents observations concerning compliance with the terms of the permit and applicable rules and regulations of the Mined Land Reclamation Board.

MINE NAME: Dawson Gold Project	MINE/PROSPECTING ID#: P-2013-002	MINERAL: Gold	COUNTY: Fremont
INSPECTION TYPE: Mineral Prospect Inspection	INSPECTOR(S): Timothy Cazier, P.E.	INSP. DATE: September 15, 2021	INSP. TIME: 10:30
OPERATOR: Zephyr Gold USA Ltd	OPERATOR REPRESENTATIVE: John Kratz & Angela Bellantoni	TYPE OF OPERATION: MP - Mineral Prospecting	

REASON FOR INSPECTION: Normal I&E Program	BOND CALCULATION TYPE: Partial Bond	BOND AMOUNT: \$107,290.00
DATE OF COMPLAINT: NA	POST INSP. CONTACTS: None	JOINT INSP. AGENCY: U.S.BLM
WEATHER: Clear	INSPECTOR'S SIGNATURE: 	SIGNATURE DATE: February 3, 2022

The following inspection topics were identified as having Problems or Possible Violations. OPERATORS SHOULD READ THE FOLLOWING PAGES CAREFULLY IN ORDER TO ASSURE COMPLIANCE WITH THE TERMS OF THE PERMIT AND APPLICABLE RULES AND REGULATIONS. If a Possible Violation is indicated, you will be notified under separate cover as to when the Mined Land Reclamation Board will consider possible enforcement action.

INSPECTION TOPIC: Sediment Control**PROBLEM/POSSIBLE VIOLATION:** Problem: The steep access road is collecting runoff and directing it off the road causing erosion. This is a problem at this time for failure to protect the affected land from erosion pursuant to C.R.S. 34-32.5-116 (4) (j).**CORRECTIVE ACTIONS:** The operator shall provide photo documentation to the Division verifying water bars have been installed or commit to backfilling the access road for final reclamation during the 2022 construction season by the corrective action date, such that further erosion is curtailed.**CORRECTIVE ACTION DUE DATE:** 5/31/22

OBSERVATIONS

This inspection was conducted as part of the regular monitoring program. The Prospector, Zephyr Gold was represented by Dr. Angela Bellantoni (Environmental Alternatives) and Mr. John Kratz during the inspection. Ms. Stephanie Carter and Ms. Amber Pike (BLM) were also present for the inspection. The Dawson Project site is located approximately 4.5 miles southwest of Cañon City, in Fremont County. The site was accessed from Temple Canyon Road/CR 3.

The primary focus of this inspection was the reclamation of the three trenches dug in the BLM managed area on the northwest side of Dawson Mountain ca. 2018 in the area known as Windy Point.

Availability of Records: Annual reports are current, having been filed through March 2021. The previous inspection was on March 20, 2019. There were no open infractions prior to the inspection. The disturbed area is a mixture of privately and federally managed surface and minerals.

Backfilling and Grading: Trenches 1 (see **Photo 1**), 2 (see **Photo 2**) and 3 (see **Photo 3**) had been backfilled. Additional roads and/or trenches up the hill to the south (see **Photo 4**) were not investigated due to time constraints, but will be visited during a future inspection. The attached **Post Inspection Map** shows the locations of the three trenches.

Financial Warranty: The \$92,655 sitewide bond held by the DRMS was last updated in August of 2020 and is adequate for the observed disturbance. It should be noted that \$14,035 of the statewide bond is allocated to P-2020-002.

Fish and Wildlife: No impact to wildlife was observed.

Hydrologic Balance: As part of the file review related to this inspection, the status of borehole abandonment reports was reviewed. DRMS records indicate 43 holes have been drilled under this NOI. A possible 44th hole may have been drilled in Windy Gulch (possible ID WG-13-21). Whether or not WG-13-21 was drilled needs to be clarified. **Attachment A** provides a summary of information provided in previously submitted abandonment reports. Ignoring WG-13-21, only two holes are missing abandonment reports: WG-16-34A (shown on Figure 1 of the abandonment report dated 10/27/2016), and WP-18-18 (found during this inspection near Trench 3, see **Photo 5**, see attached **Post Inspection Map**). All information in red text in **Attachment A** will need to be provided prior to final release. [Abandonment reports for WG-13-21 \(if drilled\), WG-16-34A, and WP-18-18 are past due as they are required to be submitted within one year of drilling/abandonment.](#)

Roads: A comparison of historic Google Earth imagery demonstrates which roads in the area inspected are new (magenta lines on the **Post Inspection Map**) and re-disturbed, previously reclaimed access roads (brown lines on the **Post Inspection Map**). All these roads will need to be backfilled per the approved NOI.

Right of Entry: BLM representatives confirmed the Zephyr Gold's right to enter was current at the time of the inspection. Zephyr Gold maintains ownership of the patented claims.

Reclamation Success: As stated above the three trenches had been backfilled and Mr. Kratz indicated they had been seeded.

Revegetation: The seeded backfill areas were observed to be inundated with Russian thistle. This is not a State

listed noxious weed, so it is not cited as a problem. There did appear to be some grasses growing under the thistle cover. No noxious weeds were observed.

Sediment Control: As part of the aforementioned Google Earth historic imagery review to determine which roads require reclamation, it was noted some erosion off the steep section of the access road (see **Photo 6**) has occurred due to the access road directing runoff along its length to the bend in the road where it is directed off the road and downhill from there. **The erosion on this segment of the access road is cited as a problem on p. 1 of this report.** If this road is not reclaimed during the 2022 construction season, water bars must be constructed to reduce this erosion problem.

Support Facilities On-site: No equipment was observed on site.

Permit Stipulations: There are no permit stipulations.

Structures: No structures were observed within 200 feet of the affected area.

Please contact Tim Cazier (303)866-3567 ext. 8169 or email at tim.cazier@state.co.us if you have any questions regarding this report.

PHOTOGRAPHS



Photo 1. Trench 1 (looking west, note heavy Russian thistle cover).

PHOTOGRAPHS (cont.)



Photo 2. Trench 2 (looking east, note heavy Russian thistle cover beyond).



Photo 3. Trench 3 (in access road requiring backfill, looking SW).

PHOTOGRAPHS (cont.)



Photo 4. Additional access road to be inspected in the near future (looking south from east of Trench 1).



Photo 5. WP-18-18 borehole site (See attached Post Inspection Map for location).

PHOTOGRAPHS (cont.)



Photo 6. Steep section of access road requiring erosion protection (BLM representatives indicate steepness).

Inspection Contact Address

John Kratz & Angela Bellantoni
Zephyr Gold USA Ltd
1107 Main St
Canon City, CO 81212

Enclosures: Post Inspection Map and Attachment A – Borehole Abandonment Tracking Log

ec: Michael Cunningham, DRMS
DRMS file
Angela Bellantoni, PhD, EAI
Stephanie Carter, BLM
Amber Pike, BLM

GENERAL INSPECTION TOPICS


The following list identifies the environmental and permit parameters inspected and gives a categorical evaluation of each

(AR) RECORDS----- <u>Y</u>	(FN) FINANCIAL WARRANTY----- <u>Y</u>	(RD) ROADS----- <u>Y</u>
(HB) HYDROLOGIC BALANCE----- <u>Y</u>	(BG) BACKFILL & GRADING----- <u>Y</u>	(EX) EXPLOSIVES----- <u>NA</u>
(PW) PROCESSING WASTE/TAILING---- <u>NA</u>	(SF) PROCESSING FACILITIES----- <u>Y</u>	(TS) TOPSOIL----- <u>N</u>
(MP) GENL MINE PLAN COMPLIANCE- <u>Y</u>	(FW) FISH & WILDLIFE----- <u>Y</u>	(RV) REVEGETATION---- <u>Y</u>
(SM) SIGNS AND MARKERS----- <u>NA</u>	(SP) STORM WATER MGT PLAN---- <u>N</u>	(RS) RECL PLAN/COMP-- <u>Y</u>
(ES) OVERBURDEN/DEV. WASTE----- <u>NA</u>	(SC) EROSION/SEDIMENTATION--- PB	(ST) STIPULATIONS----- <u>Y</u>
(AT) ACID OR TOXIC MATERIALS----- <u>N</u>	(OD) OFF-SITE DAMAGE----- <u>NA</u>	

Y = Inspected / N = Not inspected / NA = Not applicable to this operation / **PB = Problem cited** / PV = Possible violation cited

P-2013-002 Dawson Gold Project 2021 Post Inspection Map

Satellite imagery from 10/5/2019

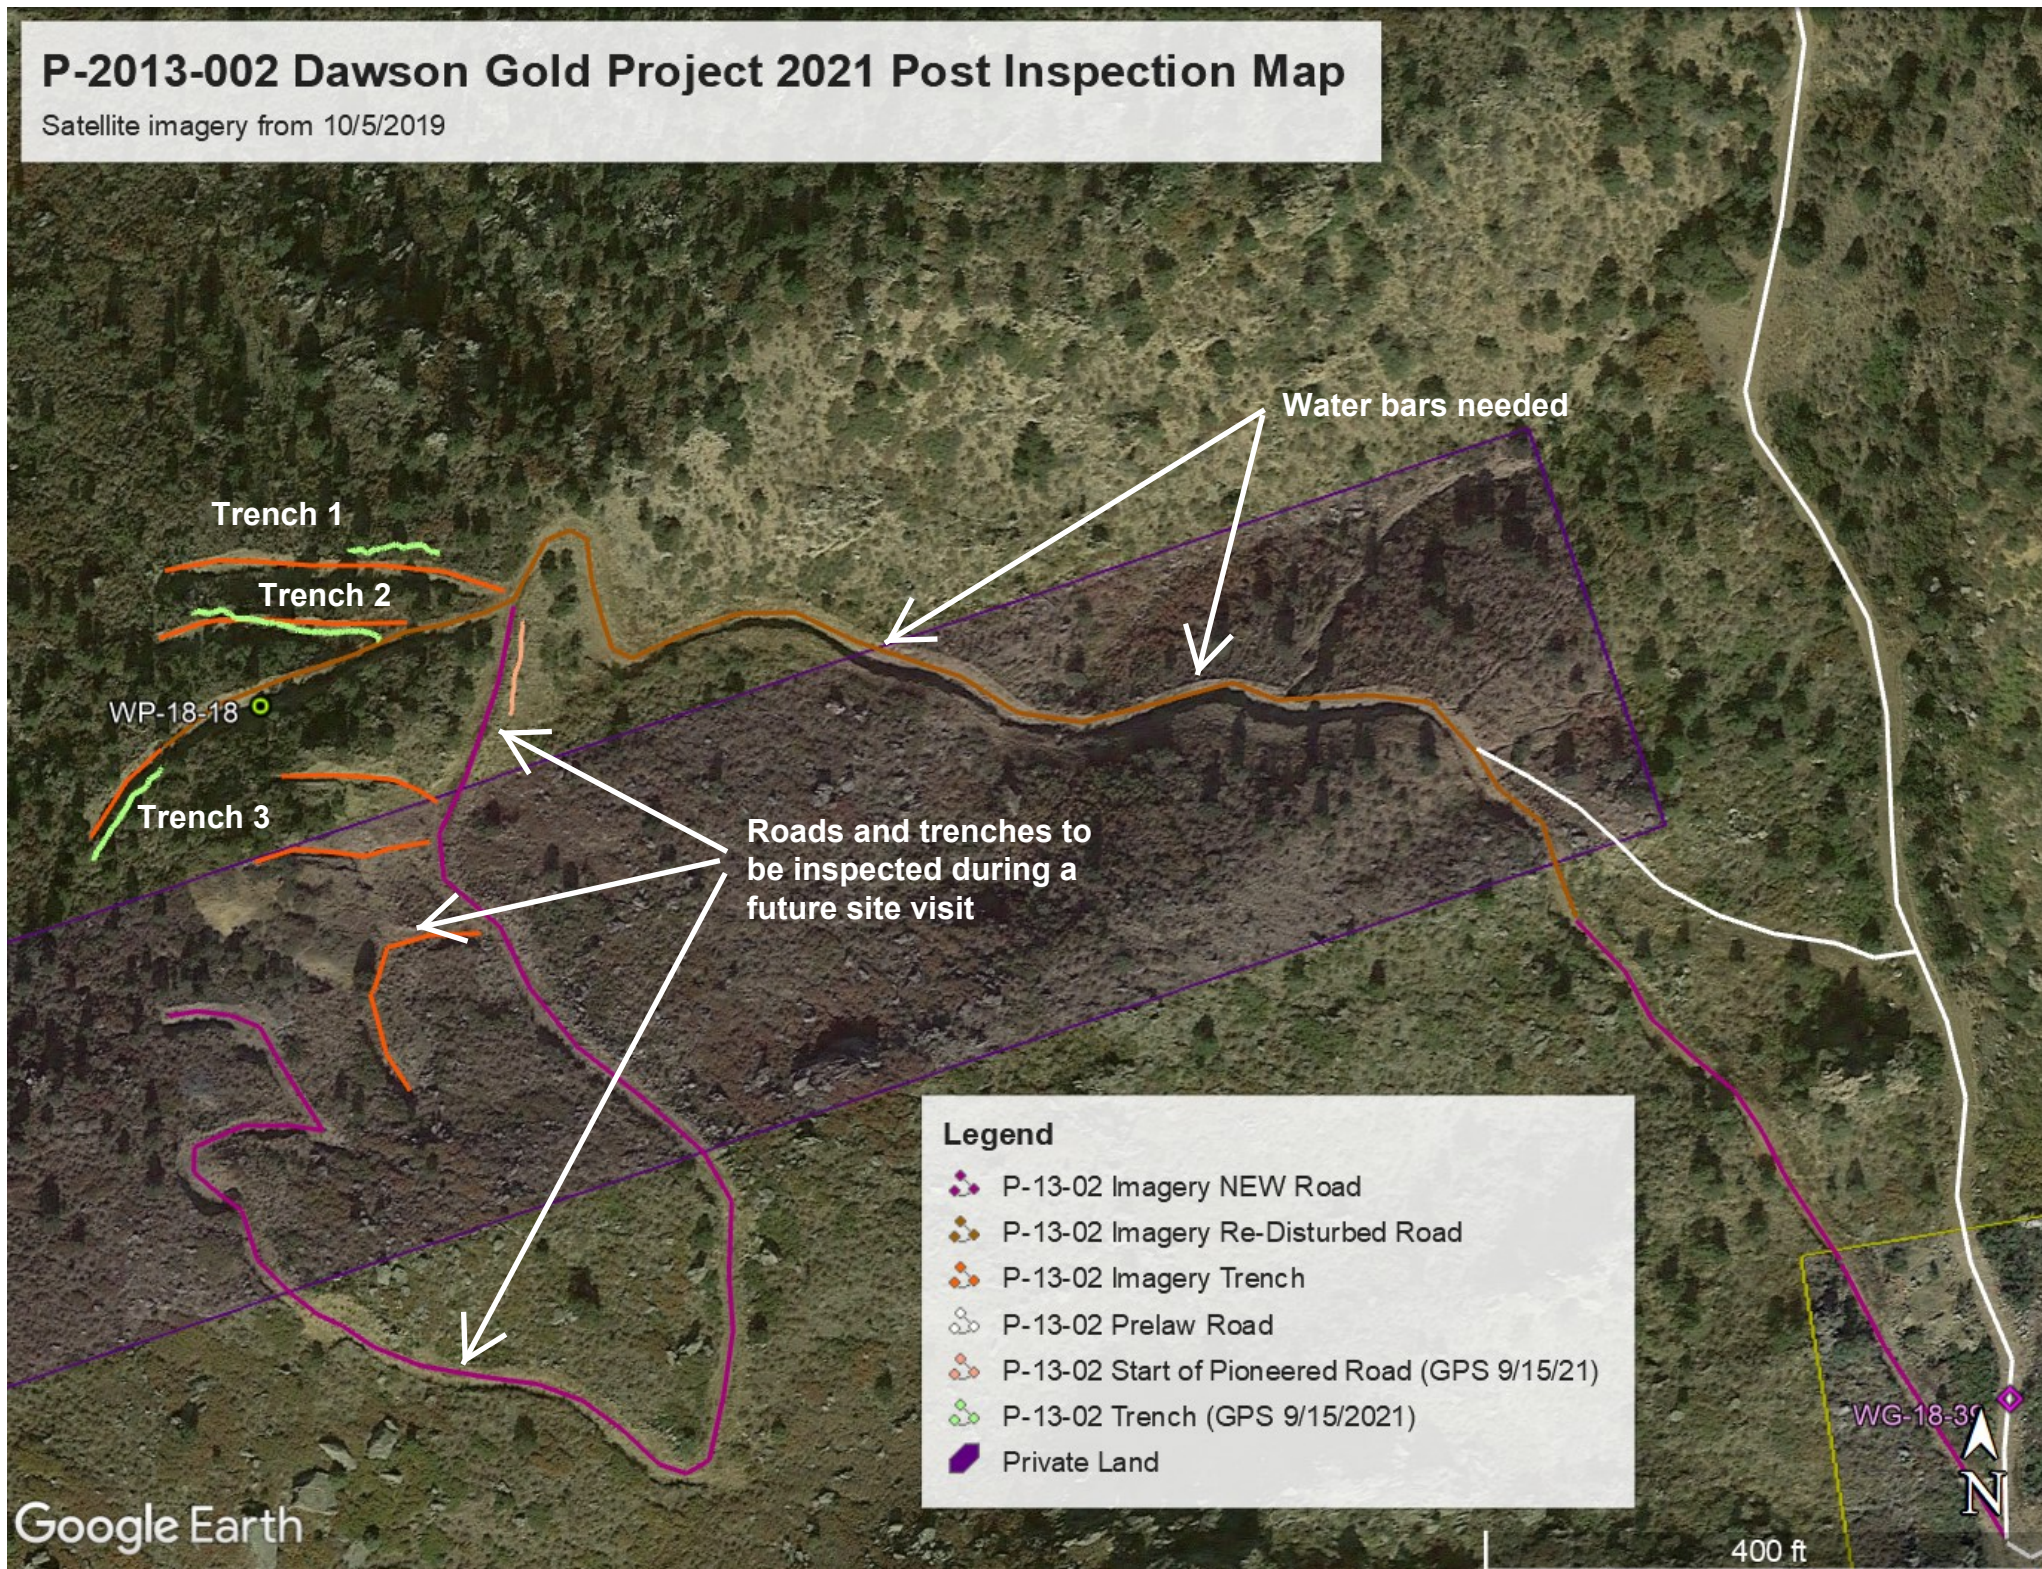

ATTACHMENT A

Borehole Tracking

Non-confidential

Page: 1

Permit No.	P-2013-002
Site Name:	Dawson Gold Project
Prospector:	Zephyr Gold USA Ltd
County:	Fremont
Specialist:	T. Cazier from TC Wait records for 2013 holes

Bore Hole ID	WG-13-08	WG-13-09	WG-13-10	WG-13-11	WG-13-12	WG-13-13
Date Drilled	4/3/2013	4/4/2013	4/5/2013	4/6/2013	4/7/2013	4/8/2013
Temporary Conversion to:	Not Applicable	Not Applicable	Not Applicable	Not Applicable	Not Applicable	Not Applicable
Date of Temp. Conv.	--	--	--	--	--	--
End Date of Temp. Conv.	--	--	--	--	--	--
Date Permanently Abandoned	4/3/2013	4/4/2013	4/5/2013	4/6/2013	4/7/2013	4/8/2013
Location:	SW1/4 T19S R71W	SW1/4 T19S R71W	SW1/4 T19S R71W	SW1/4 T19S R71W	SW1/4 T19S R71W	SW1/4 T19S R71W
Longitude (dec. deg)						
Deg-Min-Sec	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0
Latitude (decimal)						
Deg-Min-Sec	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0
Mine Grid Easting	46300.87	46300.87	46304.83	46306.21	46306.21	46306.21
Mine Grid Northing	45718.93	45718.93	45766.54	45745.06	45745.06	45745.06
Artesian Hole?	No	No	No	No	No	No
Depth of Hole Sealed (ft)	163	205	139	143	158	184
Depth to Water (ft)	DRY	DRY	DRY	DRY	DRY	DRY
PERMANENT ABANDONMENT CONVERSION TO A WATER WELL	Sealed Hole	Sealed Hole	Sealed Hole	Sealed Hole	Sealed Hole	Sealed Hole
	No	No	No	No	No	No
METHOD OF RECLAIMING DRILL SITE DISTURBANCE	Site leveled to road grade	Site leveled to road grade	Site leveled to road grade	Site leveled to road grade	Site leveled to road grade	Site leveled to road grade
PERMANENT ABANDONMENT FINAL REPORT REC'D?	Yes	Yes	Yes	Yes	Yes	Yes
Date:	7/17/2013	7/17/2013	7/17/2013	7/17/2013	7/17/2013	7/17/2013
Date Inspected	8/7/2013	8/7/2013	8/7/2013	8/7/2013	8/7/2013	8/7/2013
Date Released						
NOTES:						

LEGEND:

Borehole Tracking

Non-confidential

Page: 2

Permit No.	P-2013-002
Site Name:	Dawson Gold Project
Prospector:	Zephyr Gold USA Ltd
County:	Fremont
Specialist:	T. Cazier from TC Wait records for 2013 holes

Bore Hole ID	WG-13-14	WG-13-15	WG-13-16	WG-13-17	WG-13-18	WG-13-19
Date Drilled	4/9/2013	4/10/2013	4/11/2013	4/12/2013	4/13/2013	4/14/2013
Temporary Conversion to:	Not Applicable	Not Applicable	Not Applicable	Not Applicable	Not Applicable	Not Applicable
Date of Temp. Conv.	--	--	--	--	--	--
End Date of Temp. Conv.	--	--	--	--	--	--
Date Permanently Abandoned	4/9/2013	4/10/2013	4/11/2013	4/12/2013	4/13/2013	4/14/2013
Location:	SW1/4 T19S R71W	SW1/4 T19S R71W	SW1/4 T19S R71W	SW1/4 T19S R71W	SW1/4 T19S R71W	SW1/4 T19S R71W
Longitude (dec. deg)						
Deg-Min-Sec	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0
Latitude (decimal)						
Deg-Min-Sec	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0
Mine Grid Easting	46306.21	46150.02	46150.02	46162.42	46070.19	46070.19
Mine Grid Northing	45745.06	45610.45	45610.45	45666.42	45573.44	45573.44
Artesian Hole?	No	No	No	No	No	No
Depth of Hole Sealed (ft)	175	148	164	82	140	134
Depth to Water (ft)	DRY	DRY	DRY	DRY	DRY	DRY
PERMANENT ABANDONMENT CONVERSION TO A WATER WELL	Sealed Hole	Sealed Hole	Sealed Hole	Sealed Hole	Sealed Hole	Sealed Hole
	No	No	No	No	No	No
METHOD OF RECLAIMING DRILL SITE DISTURBANCE	Site leveled to road grade	Site leveled to road grade	Site leveled to road grade	Site leveled to road grade	Site leveled to road grade	Site leveled to road grade
PERMANENT ABANDONMENT FINAL REPORT REC'D?	Yes	Yes	Yes	Yes	Yes	Yes
Date:	7/17/2013	7/17/2013	7/17/2013	7/17/2013	7/17/2013	7/17/2013
Date Inspected	8/7/2013	8/7/2013	8/7/2013	8/7/2013	8/7/2013	8/7/2013
Date Released						
NOTES:						

LEGEND:

Borehole Tracking

Non-confidential

Page: 3

Permit No.	P-2013-002
Site Name:	Dawson Gold Project
Prospector:	Zephyr Gold USA Ltd
County:	Fremont
Specialist:	T. Cazier

Bore Hole ID	WG-13-20	WG-16-21	WG-16-22	WG-13-21	WG-16-23	WG-16-24
Date Drilled	4/14/2013			-----		
Temporary Conversion to:	Not Applicable			-----		
Date of Temp. Conv.	--			-----		
End Date of Temp. Conv.	--			-----		
Date Permanently Abandoned	4/14/2013	8/302016	8/302016	-----	8/302016	8/302016
Location:	SW1/4 T19S R71W	3056158.6W / 1203058.5N	3055966.0W / 1202976.7N		3055964.9W / 1202974.7N	3055955.7W / 1202941.6N
Longitude (dec. deg)				-----		
Deg-Min-Sec	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0
Latitude (decimal)				-----		
Deg-Min-Sec	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0
Mine Grid Easting	46076.8			-----		
Mine Grid Northing	45641.83			-----		
Artesian Hole?	No			-----		
Depth of Hole Sealed (ft)	67			-----		
Depth to Water (ft)	DRY	?	?	-----	?	?
PERMANENT ABANDONMENT CONVERSION TO A WATER WELL	Sealed Hole	Plugged dry hole	Plugged dry hole	-----	Plugged dry hole	Plugged dry hole
	No	No	No	-----	No	No
METHOD OF RECLAIMING DRILL SITE DISTURBANCE	Site leveled to road grade	Not Provided	Not Provided	-----	Not Provided	Not Provided
PERMANENT ABANDONMENT FINAL REPORT REC'D?	Yes	Yes	Yes	-----	Yes	Yes
Date:	7/17/2013	10/31/2016	10/31/2016	-----	10/31/2016	10/31/2016
Date Inspected	8/7/2013	9/29/2016		-----		
Date Released				-----		
NOTES:				Uncertain if this was drilled		

LEGEND:

3056158.6W / 1203058.5N = State Plane coordinates, US survey ft or Int'l ft?

8/302016

= Date from DWR Form "GWS-09" signed

Borehole Tracking

Non-confidential

Page: 4

Permit No.	P-2013-002
Site Name:	Dawson Gold Project
Prospector:	Zephyr Gold USA Ltd
County:	Fremont
Specialist:	T. Cazier

Bore Hole ID	WG-16-25	WG-16-26	WG-16-27	WG-16-28	WG-16-29	WG-16-30
Date Drilled						
Temporary Conversion to:						
Date of Temp. Conv.						
End Date of Temp. Conv.						
Date Permanently Abandoned	8/30/2016	8/29/2016	8/29/2016	8/29/2016	8/29/2016	8/29/2016
Location:	3055959.6W / 1202983.2N	3055940.5W / 1202938.2N	3055944.7W / 1202978.3N	3055949.2W / 1202931.3N	3055960.8W / 1202976.5N	3056156.7W / 1203077.7N
Longitude (dec. deg)						
Deg-Min-Sec			0 0 0	0 0 0	0 0 0	0 0 0
Latitude (decimal)						
Deg-Min-Sec			0 0 0	0 0 0	0 0 0	0 0 0
Mine Grid Easting						
Mine Grid Northing						
Artesian Hole?						
Depth of Hole Sealed (ft)						
Depth to Water (ft)	?	?	?	?	?	?
PERMANENT ABANDONMENT CONVERSION TO A WATER WELL	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole
	No	No	No	No	No	No
METHOD OF RECLAIMING DRILL SITE DISTURBANCE	Not Provided	Not Provided	Not Provided	Not Provided	Not Provided	Not Provided
PERMANENT ABANDONMENT FINAL REPORT REC'D?	Yes	Yes	Yes	Yes	Yes	Yes
Date:	10/31/2016	10/31/2016	10/31/2016	10/31/2016	10/31/2016	10/31/2016
Date Inspected						9/29/2016
Date Released						
NOTES:						

LEGEND:

3056158.6W / 1203058.5N = State Plane coordinates, US survey ft or Int'l ft?

8/30/2016

= Date from DWR Form "GWS-09" signed

Borehole Tracking

Non-confidential

Page: 5

Permit No.	P-2013-002
Site Name:	Dawson Gold Project
Prospector:	Zephyr Gold USA Ltd
County:	Fremont
Specialist:	T. Cazier

Bore Hole ID	WG-16-31	WG-16-32	WG-16-33	WG-16-34	WG-16-35	WG-16-36
Date Drilled						
Temporary Conversion to:						
Date of Temp. Conv.						
End Date of Temp. Conv.						
Date Permanently Abandoned	8/29/2016	8/29/2016	8/29/2016	8/29/2016	8/29/2016	8/29/2016
Location:	3055797.6W / 1202833.6N	3055789.3W / 1202832.1N	3055799.9W / 1202842.9N	3055947.2W / 1202961.7N	3055743.1W / 1202829.2N	3055422.3W / 1202789.9N
Longitude (dec. deg)						
Deg-Min-Sec	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0
Latitude (decimal)						
Deg-Min-Sec	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0	0 0 0
Mine Grid Easting						
Mine Grid Northing						
Artesian Hole?						
Depth of Hole Sealed (ft)						
Depth to Water (ft)	?	?	?	?	?	?
PERMANENT ABANDONMENT CONVERSION TO A WATER WELL	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole
	No	No	No	No	No	No
METHOD OF RECLAIMING DRILL SITE DISTURBANCE	Not Provided	Not Provided	Not Provided	Not Provided	Not Provided	Not Provided
PERMANENT ABANDONMENT FINAL REPORT REC'D?	Yes	Yes	Yes	Yes	Yes	Yes
Date:	10/31/2016	10/31/2016	10/31/2016	10/31/2016	10/31/2016	10/31/2016
Date Inspected					9/29/2016	9/29/2016
Date Released						
NOTES:						

LEGEND:

3056158.6W / 1203058.5N = State Plane coordinates, US survey ft or Int'l ft?

8/30/2016

= Date from DWR Form "GWS-09" signed

Borehole Tracking

Non-confidential

Page: 6

Permit No.	P-2013-002
Site Name:	Dawson Gold Project (2018 Holes)
Prospector:	Zephyr Gold USA Ltd
County:	Fremont
Specialist:	T. Cazier

Bore Hole ID	WG-18-37	WG-18-38	WG-18-39	WG-18-40	CK-18-08	DA-18-12
Date Drilled	7/2/2018	7/6/2018	7/9/2018	9/17/2018	5/13/2018	5/17/2018
Temporary Conversion to:	Not Applicable	Not Applicable	Not Applicable	Not Applicable	Not Applicable	Not Applicable
Date of Temp. Conv.	--	--	--	--	--	--
End Date of Temp. Conv.	--	--	--	--	--	--
Date Permanently Abandoned	7/26/2018	7/26/2018	7/26/2018	10/4/2018	7/26/2018	7/26/2018
Location:	3055758.93W / 1202734.63N	3055878.22W / 1202921.54N	3055496.52W / 1202682.57N	3055930.6W / 1202891.7N	3056986.31W / 1202941.70N	3058323.50W / 1203030.15N
Longitude (dec. deg)	105.305503	105.305075	105.306411	105.3049	105.301181	105.296539
Deg-Min-Sec	105 18 19.811	105 18 18.27	105 18 23.08	105 18 17.64	105 18 4.2516	105 17 47.54
Latitude (decimal)	38.389825	38.390331	38.389678	38.390239	38.390378	38.390614
Deg-Min-Sec	38 23 23.37	38 23 25.192	38 23 22.841	38 23 24.86	38 23 25.361	38 23 26.21
Mine Grid Easting						
Mine Grid Northing						
Artesian Hole?	No	No	No	No	No	No
Depth of Hole Sealed (ft)	343	141	371	242	371	508
Depth to Water (ft)	Dry	Dry?	Dry	Dry	Dry	Dry
PERMANENT ABANDONMENT CONVERSION TO A WATER WELL	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole
	No	No	No	No	No	No
METHOD OF RECLAIMING DRILL SITE DISTURBANCE	Not Provided	Not Provided	Not Provided	Not Provided	Not Provided	Not Provided
PERMANENT ABANDONMENT FINAL REPORT REC'D?	Yes	Yes	Yes	Yes	Yes	Yes
Date:	12/13/2018	12/13/2018	12/13/2018	12/13/2018	12/13/2018	12/13/2018
Date Inspected	3/20/2019	3/20/2019	3/20/2019	3/20/2019	3/20/2019	3/20/2019
Date Released						
NOTES:						

LEGEND: 3056158.6W / 1203058.5N = State Plane coordinates, US survey ft or Int'l ft?

105.306411 = prospector provided decimal degree conversion

Borehole Tracking

Non-confidential

Page: 7

Permit No.	P-2013-002
Site Name:	Dawson Gold Project (2018 & 2020 Holes)
Prospector:	Zephyr Gold USA Ltd
County:	Fremont
Specialist:	T. Cazier

Bore Hole ID	DA-18-13	DA-18-14	DA-18-15	DA-18-16	DA-18-17	DA-20-01
Date Drilled	5/23/2018	6/3/2018	6/19/2018	7/15/2018	8/4/2018	9/1/2020
Temporary Conversion to:	Not Applicable	Not Applicable	Not Applicable	Not Applicable	Not Applicable	Not Applicable
Date of Temp. Conv.	--	--	--	--	--	--
End Date of Temp. Conv.	--	--	--	--	--	--
Date Permanently Abandoned	7/26/2018	7/26/2018	7/26/2018	7/26/2018	8/15/2018	9/18/2020
Location:	3058458.42W / 1203047.15N	3057695.16W / 1202592.48N	3057620.78W / 1202278.97N	3057785.77W / 1202849.87N	3057621.61W / 1202281.01N	SW¼ SE¼ S14 19S 71W
Longitude (dec. deg)	105.296072	105.298739	105.299	105.298422	105.299003	Not Provided
Deg-Min-Sec	105 17 45.859	105 17 55.46	105 17 56.4	105 17 54.319	105 17 56.411	#####
Latitude (decimal)	38.390664	38.389436	38.388561	38.390144	38.388558	Not Provided
Deg-Min-Sec	38 23 26.39	38 23 21.97	38 23 18.82	38 23 24.518	38 23 18.809	#####
Mine Grid Easting						
Mine Grid Northing						
Artesian Hole?	No	No	No	No	No	No
Depth of Hole Sealed (ft)	507	816.5	931	891	952	885
Depth to Water (ft)	Dry	Dry	Dry	Dry	Dry	Dry
PERMANENT ABANDONMENT CONVERSION TO A WATER WELL	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole	Plugged dry hole
	No	No	No	No	No	No
METHOD OF RECLAIMING DRILL SITE DISTURBANCE	Not Provided	Not Provided	Not Provided	Not Provided	Not Provided	Not Provided
PERMANENT ABANDONMENT FINAL REPORT REC'D?	Yes	Yes	Yes	Yes	Yes	Yes
Date:	12/13/2018	12/13/2018	12/13/2018	12/13/2018	12/13/2018	3/8/2021
Date Inspected	3/20/2019	3/20/2019	3/20/2019	3/20/2019	3/20/2019	
Date Released						
NOTES:						GC-44 twin?

LEGEND: 3056158.6W / 1203058.5N = State Plane coordinates, US survey ft or Int'l ft?

105.306411 = prospector provided decimal degree conversion

Borehole Tracking

Page: 8

Permit No.	
Site Name:	Dawson Gold Project (Additional Holes)
Prospector:	Zephyr Gold USA Ltd
County:	Fremont
Specialist:	T. Cazier

Bore Hole ID	WP-18-18	WG-16-34A				
Date Drilled	Not Provided	Not Provided				
Temporary Conversion to:						
Date of Temp. Conv.						
End Date of Temp. Conv.						
Date Permanently Abandoned	Not Provided	Not Provided				
Location:						
Longitude (dec. deg)	Not Provided	Not Provided				
Deg-Min-Sec	#####	#####	#####	0	0	0
Latitude (decimal)	Not Provided	Not Provided				
Deg-Min-Sec	#####	#####	#####	0	0	0
Mine Grid Easting						
Mine Grid Northing						
Artesian Hole?	Not Provided	Not Provided				
Depth of Hole Sealed (ft)	Not Provided	Not Provided				
Depth to Water (ft)	Not Provided	Not Provided				
PERMANENT ABANDONMENT CONVERSION TO A WATER WELL	Not Provided	Not Provided				
METHOD OF RECLAIMING DRILL SITE DISTURBANCE	Not Provided	Not Provided				
PERMANENT ABANDONMENT FINAL REPORT REC'D?	No	No				
Date:						
Date Inspected	9/15/2021					
Date Released						
NOTES:	Field located ONLY	Reference 10/27/16 Abandonment Report, Figure 1				

LEGEND: