Stream: Grace Creek

Executive Summary

Water Division: 1 Water District: 48 CDOW#: 11053 CWCB ID: 12/1/A-002

Segment: Confluence of North Fork and South Fork Grace Creek to Grace Creek Ditch Headgate **Upper Terminus**: CONFLUENCE OF NF AND SF GRACE CREEK (Latitude 40° 54' 55.61"N) (Longitude 106° 03' 0.02"W)

Lower Terminus: GRACE CREEK DITCH HEADGATE (Latitude 40° 59' 25.09"N) (Longitude 106° 00' 40.49"W)

Watershed: Upper Laramie (HUC#: 10180010) Counties: Larimer Length: 2.46 miles USGS Quad(s): Old Roach Flow Recommendation: 5.5 cfs (May 1 – August 15) 3.6 cfs (August 16 – October 31)

2.0 cfs (November 1 – April 30)



Staff Analysis and Recommendation

Summary

The information contained in this report and the associated supporting data and analyses (located on the enclosed CD) forms the basis for staff's instream flow recommendation to be considered by the Board. It is staff's opinion that the information contained in this report is sufficient to support the findings required in Rule 5.40.

Colorado's Instream Flow Program was created in 1973 when the Colorado State Legislature recognized "the need to correlate the activities of mankind with some reasonable preservation of the natural environment" (see 37-92-102 (3) C.R.S.). The statute vests the CWCB with the exclusive authority to appropriate and acquire instream flow and natural lake level water rights. In order to encourage other entities to participate in Colorado's Instream Flow Program, the statute directs the CWCB to request instream flow recommendations from other state and federal agencies. The Bureau of Land Management (BLM) recommended this segment of Grace Creek to the CWCB for inclusion in the Instream Flow Program. Grace Creek is being considered for inclusion into the Instream Flow Program because it has a natural environment that can be preserved to a reasonable degree with an instream flow water right.

Grace Creek is approximately 5.8 miles long and originates at the confluence of North Fork and South Fork Grace Creek at an elevation of 8,480 feet. It flows generally northeasterly as it drops to an elevation of 7,800 feet where it joins the Laramie River. One hundred percent of the land on the 2.46 mile segment addressed by this report is publicly owned. Grace Creek is located within Larimer County and the total drainage area of the creek is approximately 14 square miles.

The subject of this report is a segment of Grace Creek beginning at the confluence of North Fork and South Fork Grace Creek and extending downstream to the Grace Creek Ditch headgate. The proposed segment is located approximately 17.5 miles northeast of the town of Walden. Staff has received one recommendation for this segment, from the BLM. The recommendation for this segment is discussed below.

Instream Flow Recommendation

The BLM recommended 5.5 cfs (May 1 – August 15), 3.6 cfs (August 16 – October 31) and 2.0 cfs (November 1 – April 30) based on its August, 2, 2010 data collection efforts and staff's water availability analyses.

Land Status Review

Upper Terminus	Lower Terminus	Total Length	Land Ownership	
		(miles)	% Private	% Public
Confluence of North	Grace Creek Ditch			
Fork and South Fork	Headgate	2.46	0%	100 %
Grace Creek				

59 % of the lands are managed by the USFS and 41 % of the lands are managed by the BLM.

Biological Data

Grace Creek is a cold-water stream with moderate gradient, functional floodplains, and active beaver dams. The stream has a good mix of riffle, run, and deep pool habitats. Fish surveys show that Grace Creek supports naturally reproducing brown trout and longnose sucker populations. Intensive macroinvertebrate surveys have not been conducted, but spot samples have revealed primarily caddisfly and midge larvae, with small population of stonefly and mayfly.

The riparian community occupies most of the floodplain area and is comprised primarily of willows, spruce, and sedges. The healthy riparian community has resulted in normal width-to-depth ratios, sinuosity, and bank stability.

Field Survey Data

BLM staff used the R2Cross methodology to quantify the amount of water required to preserve the natural environment to a reasonable degree. The R2Cross method requires that stream discharge and channel profile data be collected in a riffle stream habitat type. Riffles are most easily visualized, as the stream habitat types that would dry up first should streamflow cease. This type of hydraulic data collection consists of setting up a transect, surveying the stream channel geometry, and measuring the stream discharge.

Biological Flow Recommendation

The CWCB staff relied upon the biological expertise of the BLM to interpret output from the R2Cross data collected to develop the initial, biologic instream flow recommendation. This initial recommendation is designed to address the unique biologic requirements of each stream without regard to water availability. Three instream flow hydraulic parameters, average depth, percent wetted perimeter, and average velocity are used to develop biologic instream flow recommendations. Colorado Parks and Wildlife has determined that maintaining these three hydraulic parameters at adequate levels across riffle habitat types, aquatic habitat in pools and runs will also be maintained for most life stages of fish and aquatic invertebrates (Nehring 1979; Espegren 1996).

For this segment of stream, two data sets were collected, with the results shown in Table 1 below. Table 1 shows who collected the data (Party), the date the data was collected (Date), the measured discharge at the time of the survey (Q), the accuracy range of the predicted flows based on Manning's Equation (240% and 40% of Q), the summer flow recommendation based on meeting 3 of 3 hydraulic criteria and the winter flow recommendation based upon 2 of 3 hydraulic criteria. Recommendations that fall outside of the accuracy range of the model, over 250% of the measured discharge or under 40% of the measured discharge may not give an accurate estimate of the necessary instream flow required.

Table 1: Data

Party	Date	Q	250%-40%	Summer (3/3)	Winter (2/3)
BLM	8/2/2010	10.36	25.9 - 4.1	5.87	Out of Range
BLM	8/2/2010	10.27	25.7 - 4.1	5.10	4.16
Averages				5.49	4.16

5.5 cubic feet per second is recommended for the higher temperature period, from May 1 through August 15. This recommendation is driven by the average depth criteria. It is important to maintain adequate depth in the riffles in this creek, because the riffles tend to be wide and shallow. The typical riffles are shallow due to high snowmelt runoff flows and their location on finer materials, rather than bedrock.

3.6 cubic feet per second is recommended for late summer and early fall, from August 16 to October 31. This recommendation is driven by the wetted perimeter criteria, as would be expected in a stream with shallow, wide riffles. It is important to wet as much of the channel as possible during this period, because macroinvertebrates and fish are still actively completing life cycles before the winter freeze.

2.0 cubic feet per second is recommended for the cold temperature period from November 1 to April 30. This recommendation has been reduced due to limited water availability, but this flow still provides 1.15 feet per second average velocity, 40 % wetted perimeter, and 0.17 feet average depth. The BLM believes that this flow rate should provide sufficient velocity and depth to prevent icing of all physical habitat within the stream.

Hydrologic Data and Analysis

After receiving the cooperating agency's biologic recommendation, the CWCB staff conducted an evaluation of the stream hydrology to determine if water was physically available for an instream flow appropriation. This evaluation was done through a computation that is, in essence, a "water balance". In concept, a "water balance" computation can be viewed as an accounting exercise. When done in its most rigorous form, the water balance parses precipitation into all the avenues water pursues after it is deposited as rain, snow, or ice. In other words, given a specified amount of water deposition (input), the balance tries to account for all water depletions (losses) until a selected end point is reached. Water losses include depletions due to evaporation and transpiration, deliveries into ground water storage, temporary surface storage, incorporations into plant and animal tissue and so forth. These losses are individually or collectively subtracted from the input to reveal the net amount of stream runoff as represented by the discharge measured by stream gages.

CWCB staff attempts to use this idea of balancing inputs and losses to determine if water is available for the recommended instream flow appropriation. Of course, this effort must be a practical exercise rather than a lengthy, and costly, scientific investigation. As a result, staff simplifies the process by lumping together some variables and employing certain rational and scientifically supportable assumptions. The process that is typically used by Staff incorporates, where possible, diversion records as well as the stream gage data collected by the US Geological Survey and DNR's Water Resources Division. All of these data are available in the DWR database called Hydrobase.

To determine water availability, Staff begins by characterizing the hydrologic regime at the Lower Terminus (LT) of the recommended ISF reach. In the best case, this means looking at data that has been collected for a long period of time from a gage that is located <u>at</u> the LT. Preferably, the period of data collection includes both wet and dry conditions. However, in the case of Grace Creek, there is no gage and hence no record of discharge collected by either the USGS or DWR. Lacking such data, the description of flow above the Grace Creek LT can only be indirectly described through reference to a "representative" gage station. There are two USGS gage stations in reasonably close proximity to Grace Creek, either of which could represent the hydrologic functioning of Grace Creek. The first of these is LARAMIE RIVER NEAR GLENDEVEY, CO (USGS 06657500). This gage is at an elevation of 8230 ft above mean sea level (amsl), has a generally North – South orientation, and a drainage area of 101 mi². The period of record (POR) of 74 years was collected between 1904 and 1982. The hydrograph (plot of discharge over time) for this gage includes consumptive depletions from several diversions, although diversions and consumptive uses do not necessarily constitute a major limitation upon the use of the data from the gage.

The second gage is SAND CREEK AT COLORADO – WYOMING STATE LINE (USGS 066595800) This gage is at an elevation of 7580 ft amsl, has a generally Southwest – Northeast orientation, and a drainage area of 29.2 mi². The POR of 44 years was collected between 1968 and 2011. The hydrograph for this gage includes consumptive depletions due to stockwater use and out-of-basin transfers, although such uses and transfers do not necessarily constitute a major limitation upon the use of the data from the gage.


The gages described above were found to have certain limitations that compromised their potential for use as gages "representative" of the hydrology of Grace Creek. The greatest limitation was found in the low flow periods of Fall through Spring – the period of greatest importance to instream flow recommendations. With the exception of three years (1969 – 1971), the Sand Creek gage contained virtually no data from 1 October until 1 April. A plot of the annual hydrograph that relied upon those three years to represent the low flow period resulted in an uncharacteristic graph with low flow values that had high standard deviations and conflicted with on-the-ground observations. Even though the Sand Creek watershed was otherwise well suited to serve as "representative" of Grace Creek (similar size, orientation, shape, elevation, location, a long POR, etc), the paucity of low discharge values rendered the record of little or no value in the characterization of the hydrology of Grace Creek.

The Laramie River gage had similar problems. This gage did not suffer from the same problem as Sand Creek with respect to the absence of low flow data. However, the gage record, although long, was not as current as that of Sand Creek and the basin orientation was nearly perpendicular to that of Grace Creek and the other Laramie River basin creeks being recommended. While the Laramie River gage low flow records were approved for publication, a certain uniformity in values, especially in the older data led to some concern that more estimates of flow may have been made than has been noted in the

record. This is of importance because of the difficulty of verification due to the dearth of low flow season data in the Sand Creek record.

Hydrograph development for ungaged streams becomes more difficult when Staff finds itself with a lack of gage data on a recommended stream and no "representative" gage is available due to the absence of nearby gage stations or because the nearby gage station records are unusable. Under these circumstances, Staff may be forced to employ a basin characteristics approach to determine mean monthly discharge values for the ungaged watershed. The method used, called StreamStats, was developed by the USGS for the estimation of mean monthly discharge (and other flow-related parameters) at ungaged sites through the use of watershed attributes. The attributes used may include precipitation, basin area, amount of basin above 7,500 ft elevation, and other morphological indices.

For Grace Creek, Staff's StreamStats analysis resulted in a mean monthly hydrograph, which was used to help determine the reasonableness of the results obtained by using a simple area proration of the daily data from the Laramie River Gage. The following prorated median flow hydrograph utilizing the Laramie River gage data shows that water is available for appropriation.

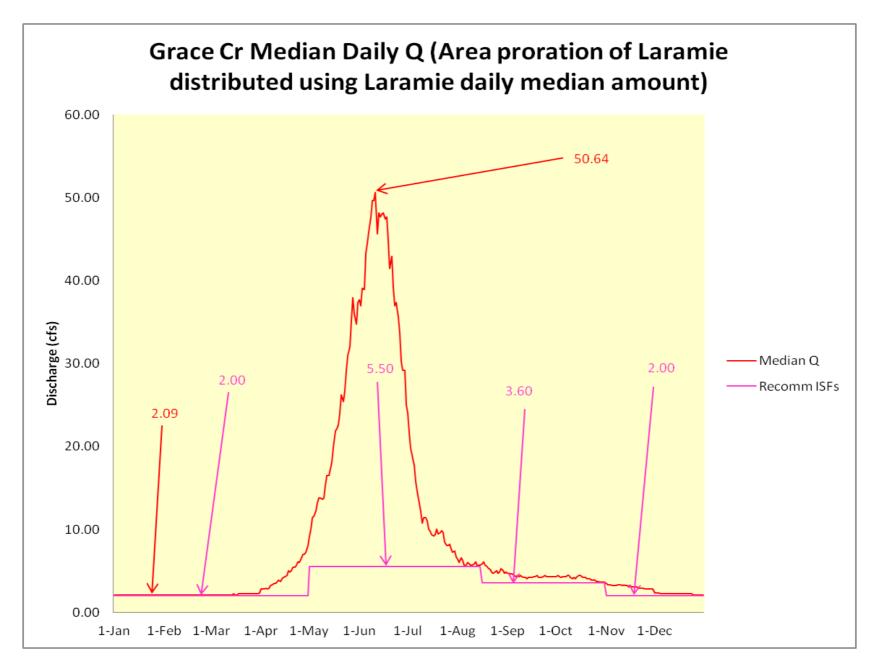

Existing Water Right Information

Staff has analyzed the water rights tabulation and contacted the Division Engineer Office (DEO) to identify any potential water availability problems. There are no decreed surface diversions within this reach of stream. Staff has determined that water is available for appropriation on Grace Creek between the Confluence of North Fork and South Fork Grace Creek to Confluence with Laramie River, to preserve the natural environment to a reasonable degree without limiting or foreclosing the exercise of valid existing water rights.

CWCB Staff's Instream Flow Recommendation

Staff recommends the Board form its intent to appropriate on the following stream reach:


Segment: Confluence of North Fork and South Fork Grace Creek to Grace Creek Ditch Headgate
Upper Terminus: CONFLUENCE OF NF AND SF GRACE CREEK
(Latitude 40° 54' 55.61"N) (Longitude 106° 03' 0.02"W)
UTM North: 4529901.69 UTM East: 411579.45
NW NW Section 21, Township 11 North, Range 77 West 6th PM
277' East of the West Section Line; 513' South of the North Section Line

Lower Terminus: GRACE CREEK DITCH HEADGATE

(Latitude 40° 59' 25.09"N) (Longitude 106° 00' 40.49"W)
UTM North: 4531421.22 UTM East: 414861.39
NW NW Section 14, Township 11 North, Range 77 West 6th PM
477' East of the West Section Line; 433' South of the North Section Line

Watershed: Upper Laramie (HUC#: 10180010) Counties: Larimer Length: 2.46 miles USGS Quad(s): Old Roach Flow Recommendation: 5.5 cfs (May 1 – August 15) 3.6 cfs (August 16 – October 31) 2.0 cfs (November 1 – April 30)

Vicinity Map

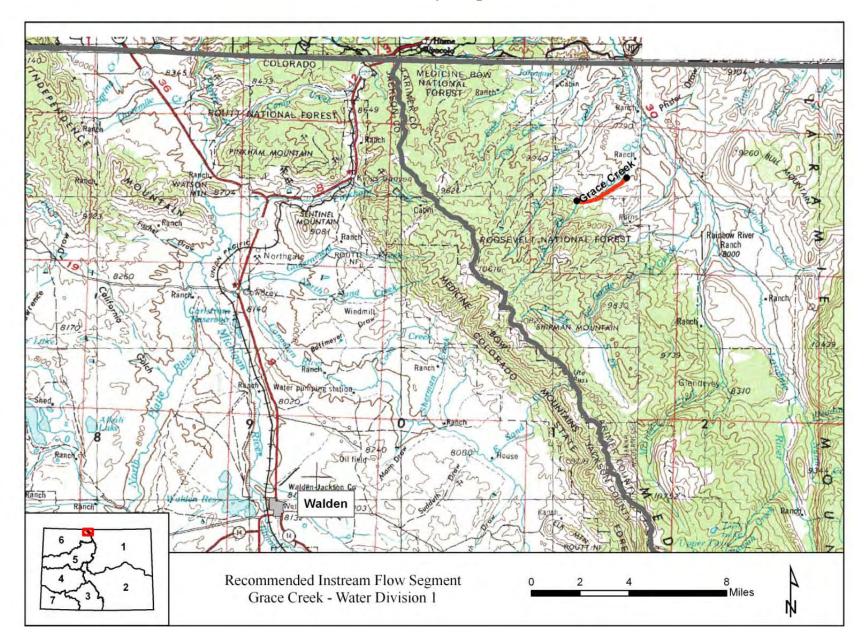

Water Rights Map

