

April 28, 2020

SENT VIA EMAIL

Mr. Patrick Lennberg
Environmental Protection Specialist
Colorado Department of Natural Resources
Division of Reclamation, Mining, and Safety
Office of Mined Land Reclamation
1313 Sherman Street, Room 215
Denver, Colorado 80203

Re: Permit No. M-1980-244; Cripple Creek & Victor Gold Mining Company ("CC&V"); Cresson Project – Notification of Water Quality Analysis Parameter Exceedance April 22, 2020

Dear Mr. Lennberg,


In accordance with Rule 9, Section 3.1.7 of the Mineral Rules and Regulations of the Colorado Mined Land Reclamation Board for Hard Rock, Metal, and Designated Mining Operations (Rules), the Cripple Creek and Victor Gold Mining Company (CC&V) hereby provide the Division of Reclamation, Mining, and Safety (Division) with a formal notification of water quality parameter exceedances.

CC&V collected second quarter compliance groundwater samples from monitoring wells CRMW-5B, CRMW-5C, and SGMW-6B on April 8, 2020. CC&V received the lab report for these analyses on April 17, 2020, and upon review, CC&V determined that CRMW-5B, and CRMW-5C exceeded established numeric protection limits for fluoride, and SGMW-6B exceeded established numeric protection limits for fluoride, manganese, and sulfate. The table below lists the exceedance for the location and the associated parameter and the attached graph demonstrates the parameter trend for collected data from Q1 2017 to present. As requested please see the attached map presenting the locations of the wells referenced within this notification.

Location	Sample Date	Parameter	Value (mg/L)	NPL (mg/L)	Table Standard (mg/L)
CRMW-5B	4/8/2020	Fluoride	2.72	2.0	2.0
CRMW-5C	4/8/2020	Fluoride	2.98	2.0	2.0
SGMW-6B	4/8/2020	Fluoride	6.83	2.0	2.0
SGMW-6B	4/8/2020	Manganese	6.46	3.0	0.05
SGMW-6B	4/8/2020	Sulfate	905	250	250

Should you require further information please do not hesitate to contact Ronald Parratt at 719.689.4019 or ronald.parratt@newmont.com or myself at 719.689.4042 or justin.raglin@newmont.com


Sincerely,




Justin Raglin
S&ER Manager
Cripple Creek & Victor Gold Mine

Attachments


CRMW-5B

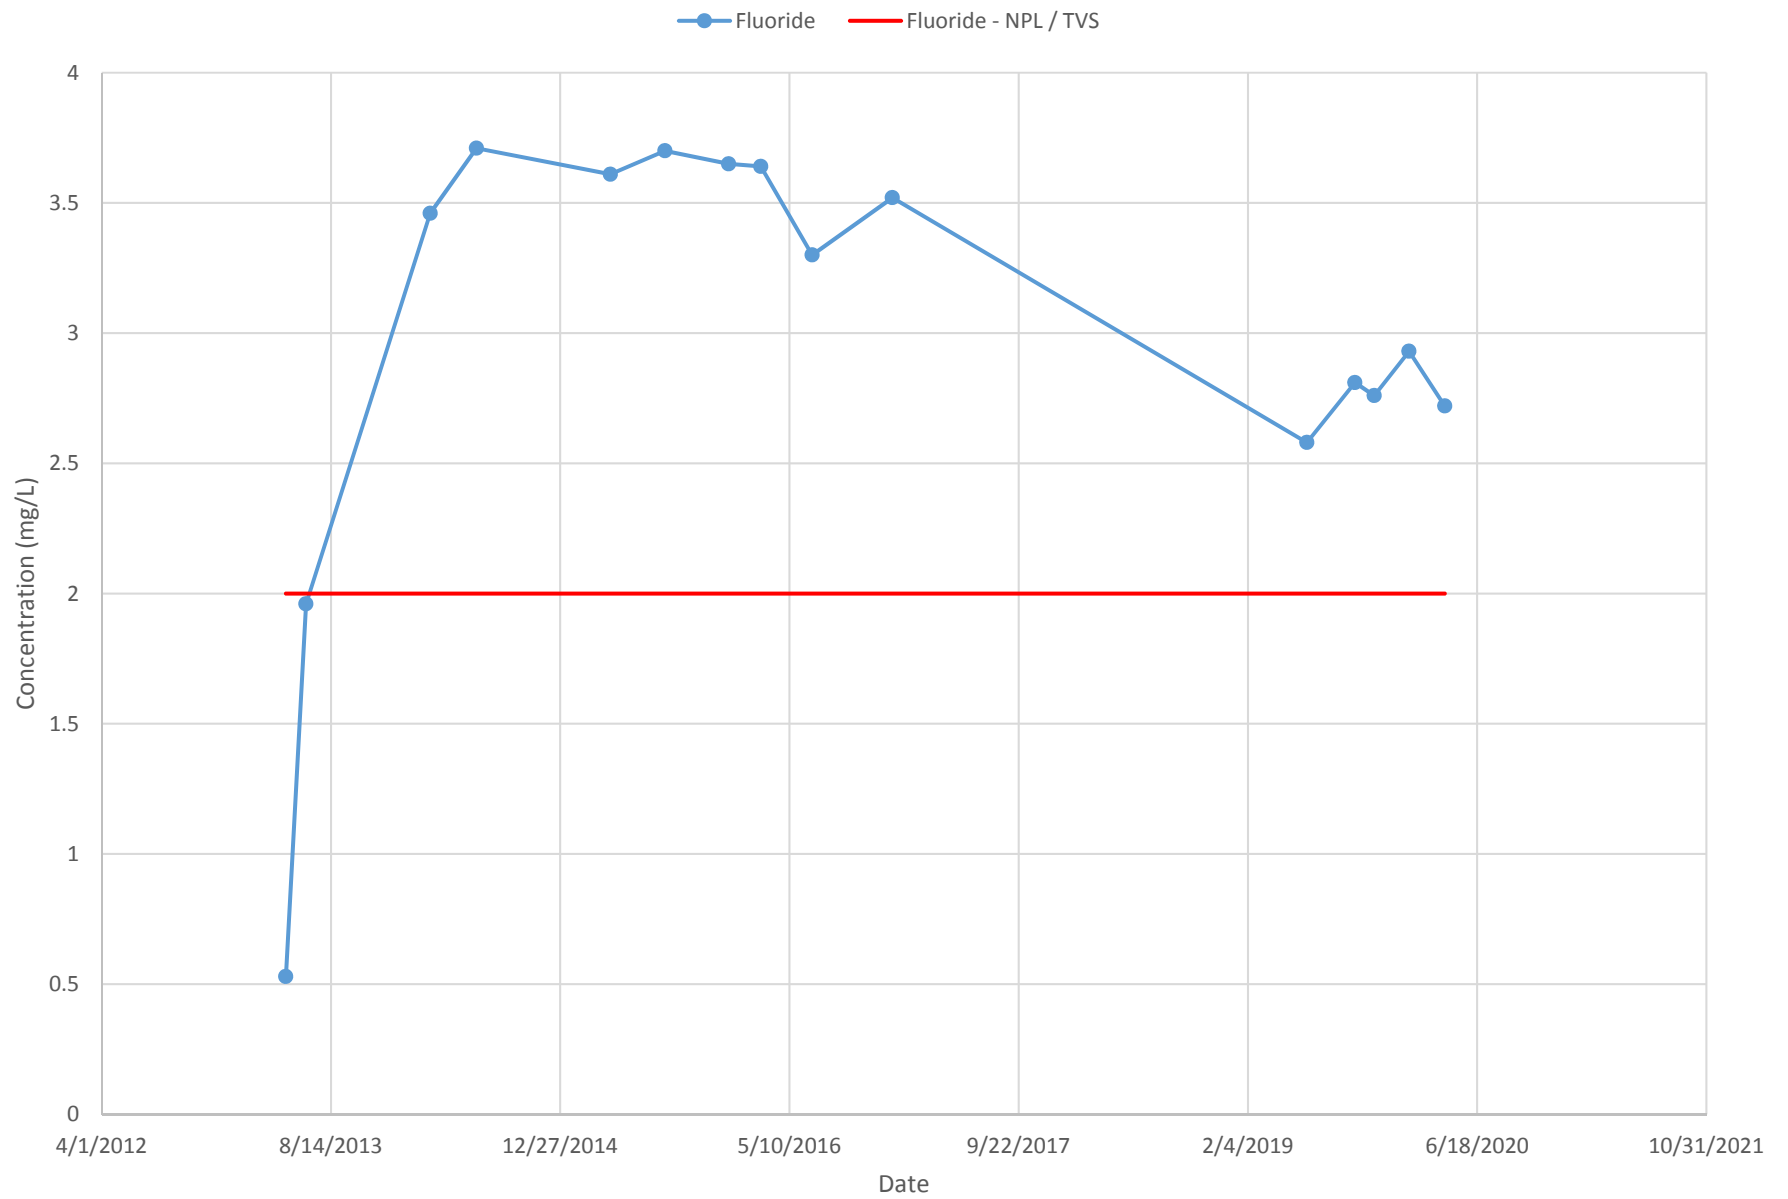


CRMW-5C

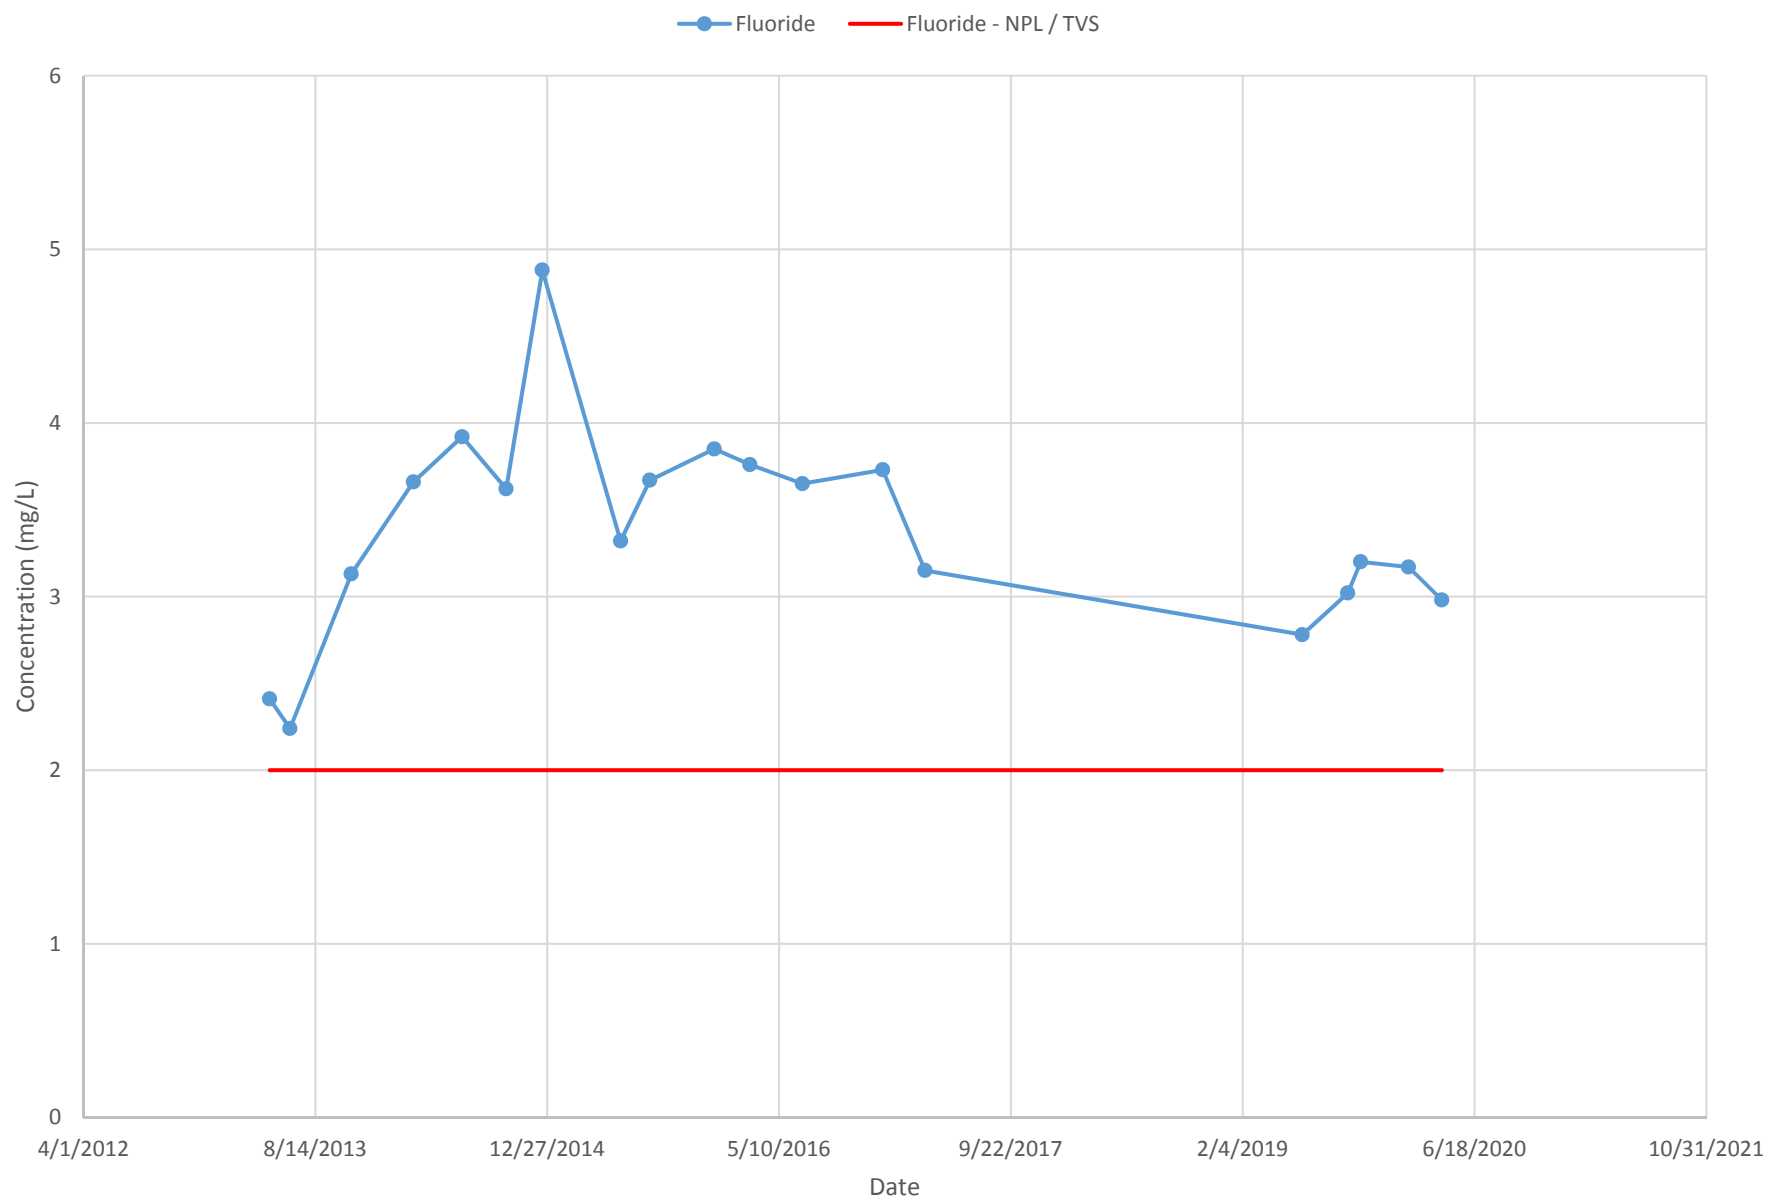


SGMW-6B

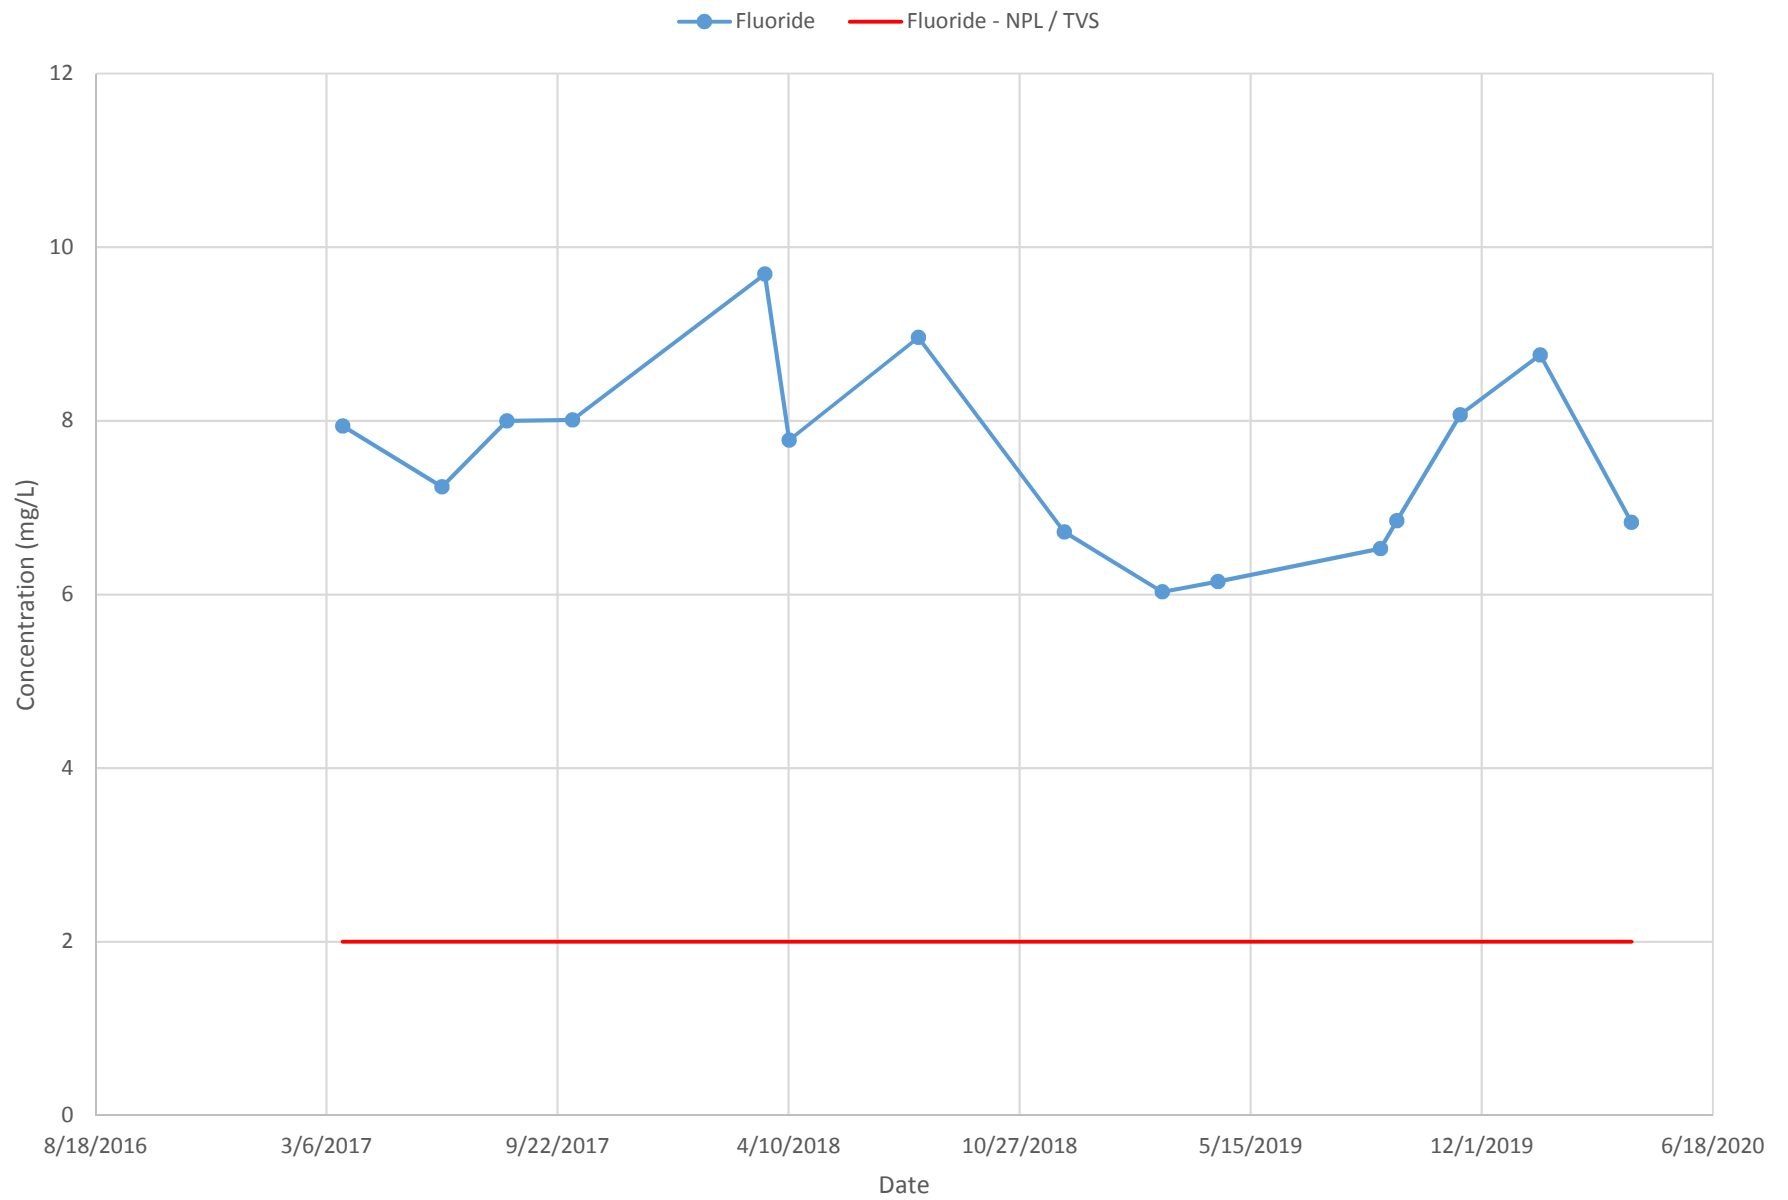

SGMW-6B

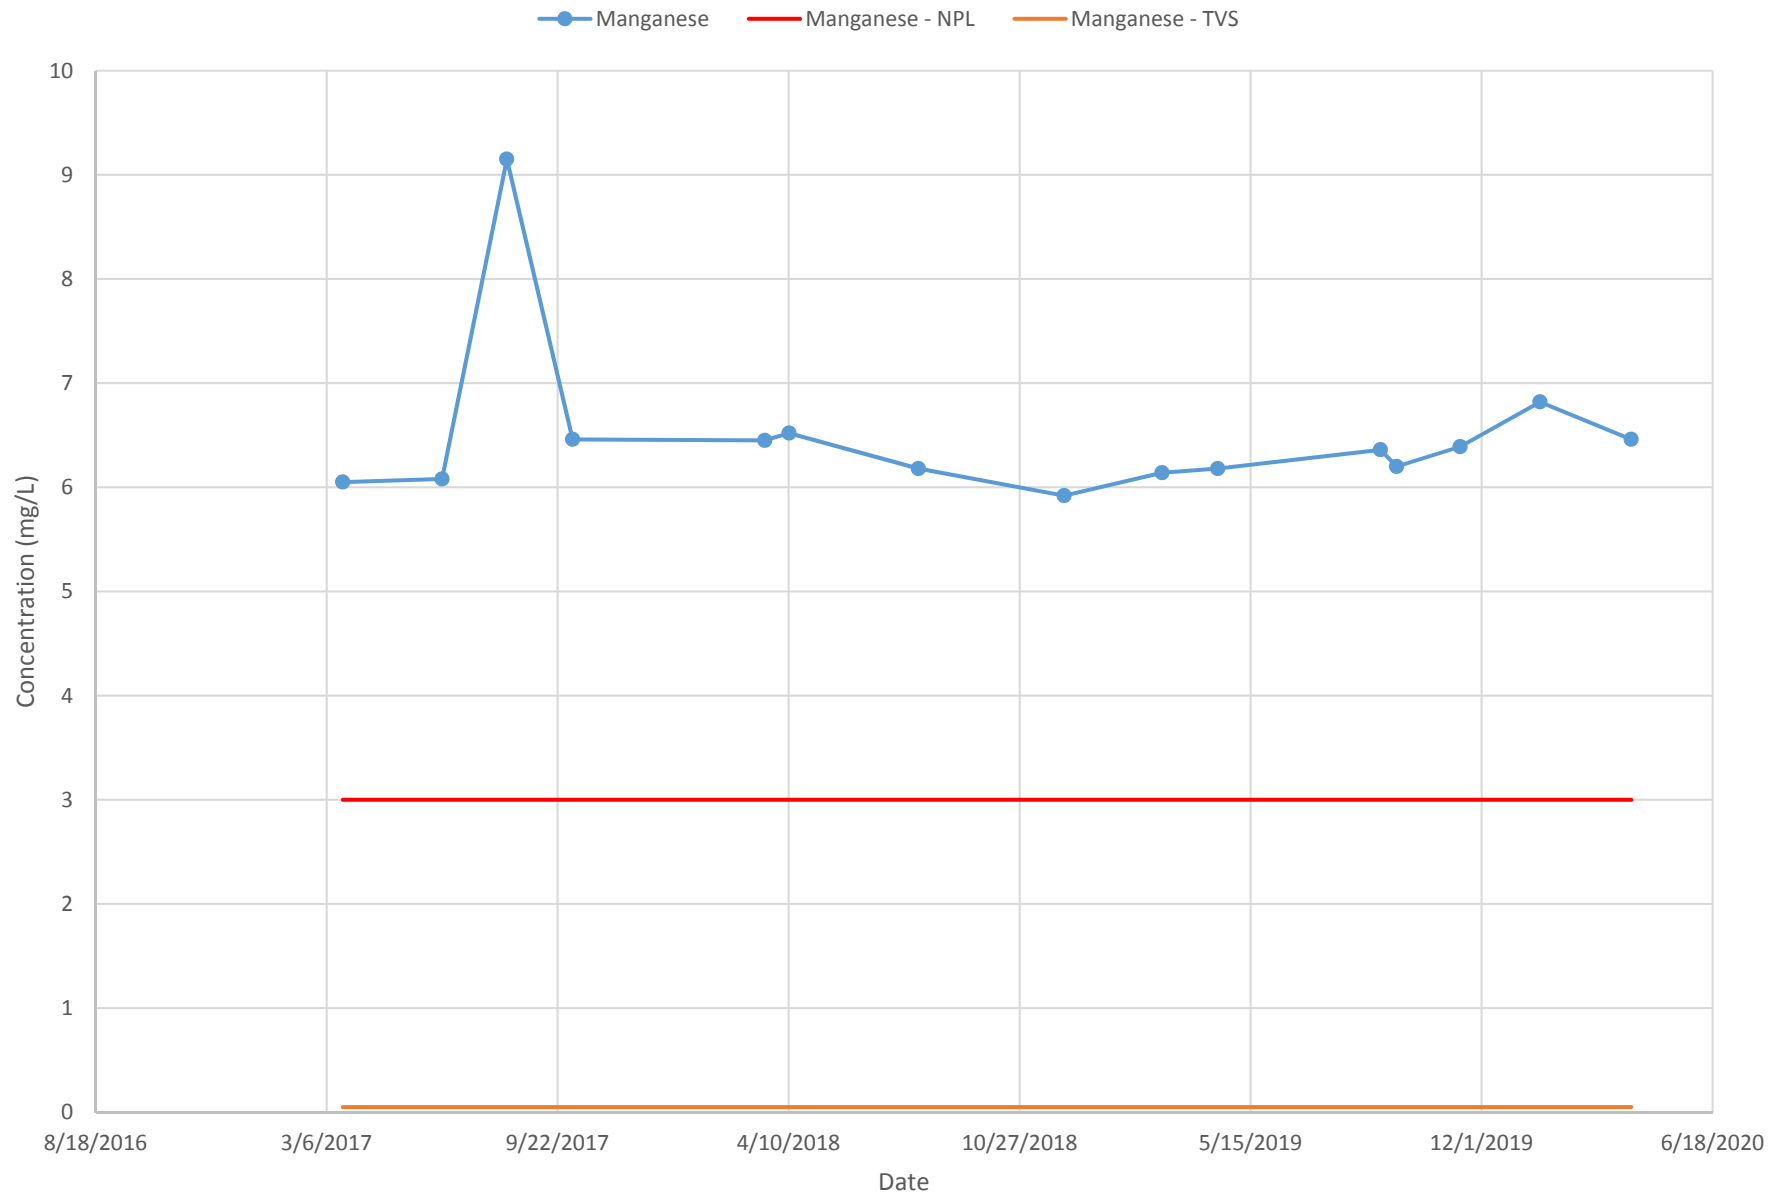

SGMW-6B

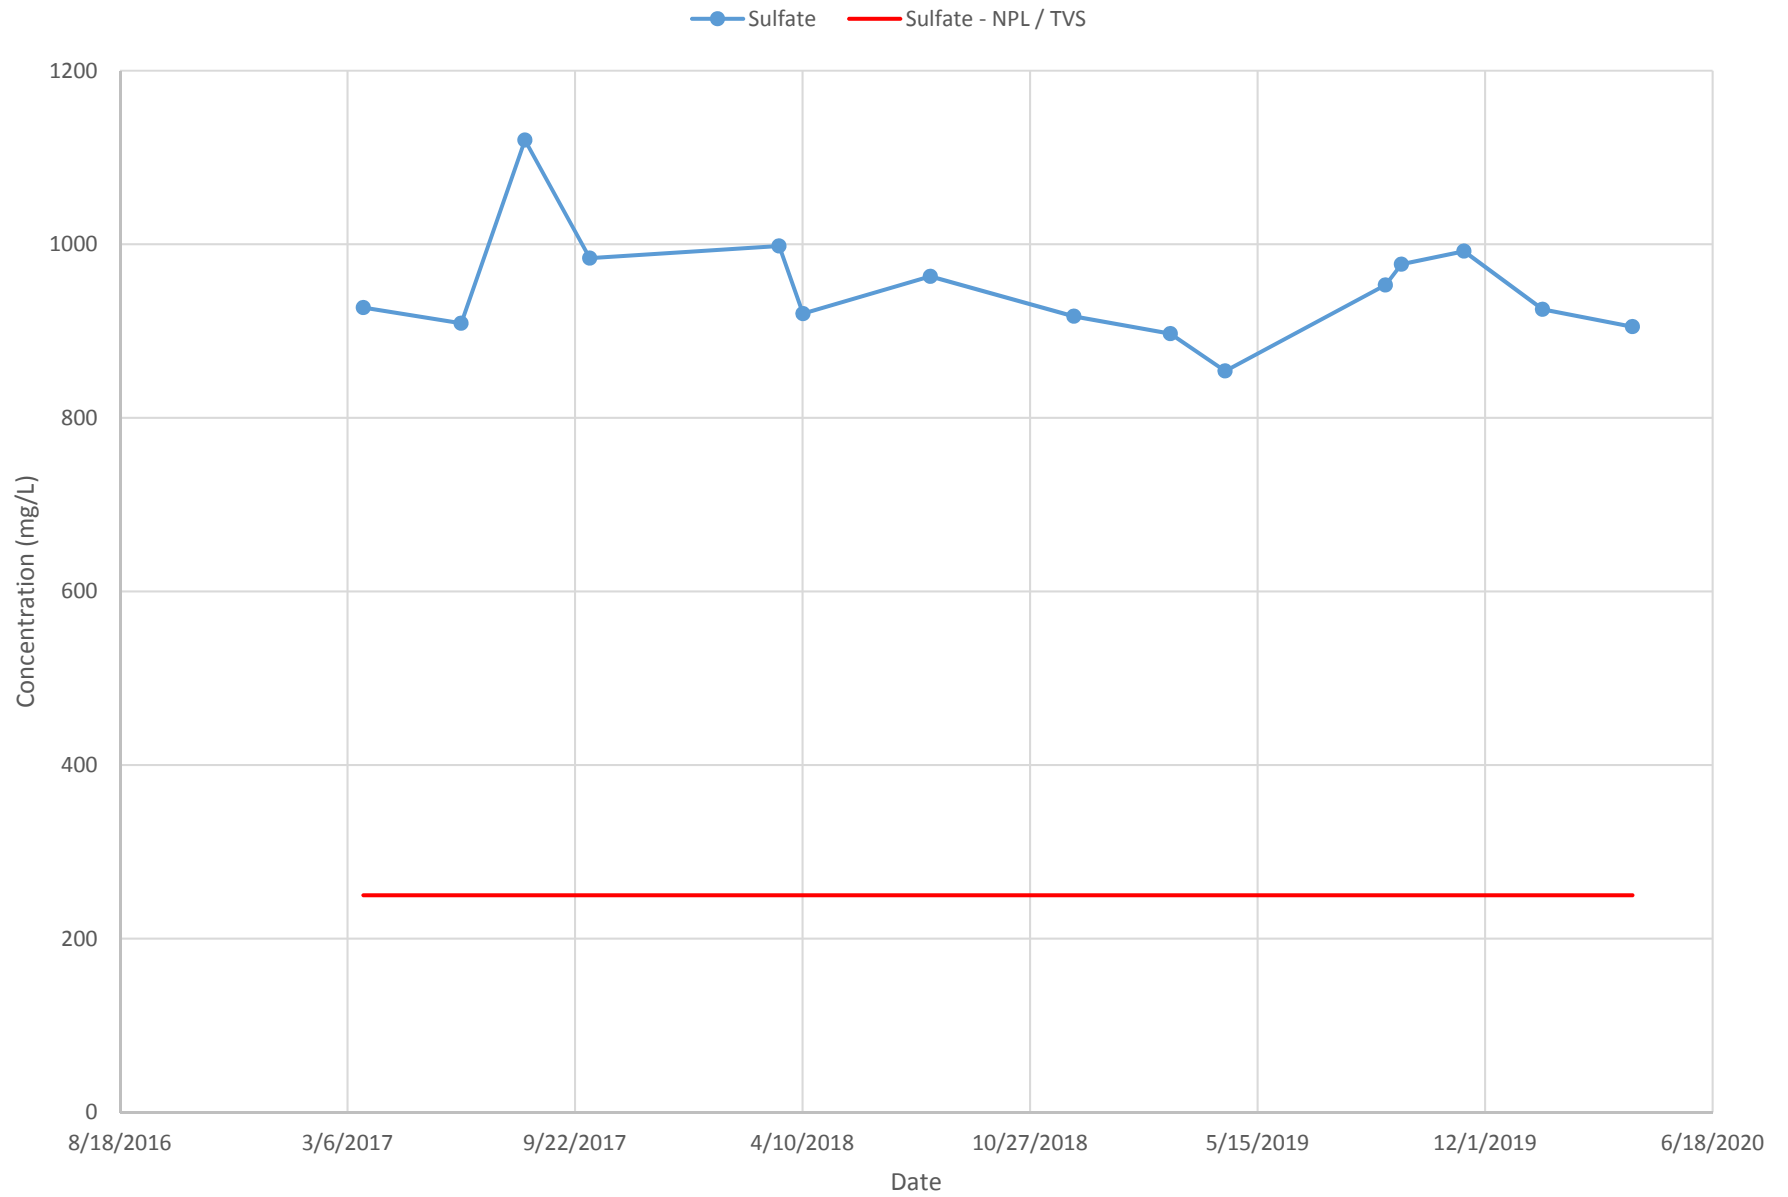

**Monitoring Well Locations
SGMW-6B & CRMW-5A,
CRMW-5B, CRMW-5C, CRMW-5D**

Author: R. Parratt

Date: 04/2020

1 inch = 2,000 feet

Figure 1

File: CC&V_ Exceedance Notification 4-22-20

