

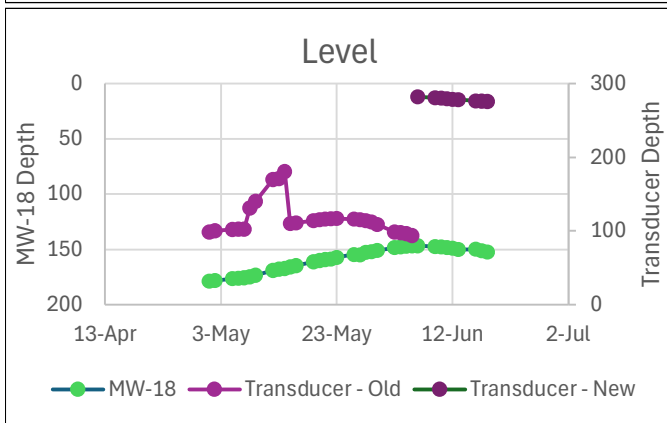


Schwartzwalder Daily Summary Report

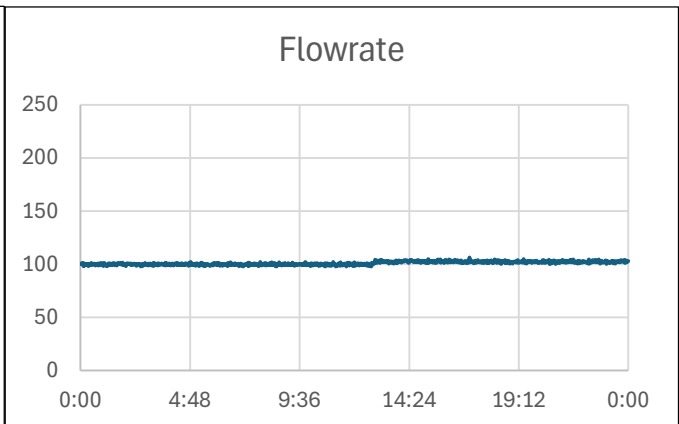

Report Date:	6/18/2025	Lead Operator:	Patrick D
		Assistant Operator(s):	Bryant A

Effluent Discharged:	0.014 Mgal	MW-18 Level:	152.5 ft
Average Flowrate:	101.1 gpm	Transducer Level:	275.6 ft
Effluent to Date:	1.734 Mgal		

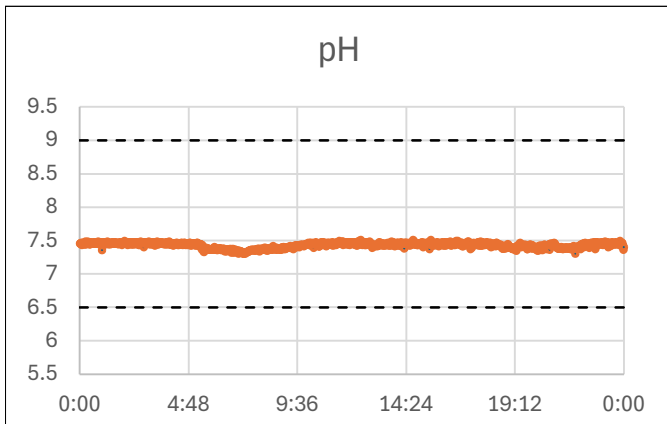

Finished Water Quality			
Parameters	Temp	pH	Cond
Values	19°C	7.65	159 μ S/cm

Chemical Inventory			
Chemicals	Antiscalant	NaOH	BaCl
Vol. Used	4 Gal	12 Gal	10 Gal
Vol. Remaining	445 Gal	187 Gal	30 Gal
Vol. Staged	0 Gal	333 Gal	270 Gal
Days Available	111 Days	45 Days	30 Days

Safety Issues/Concerns:

- N/A

Notes:

- Collected and Shipped SWA-001 , SW-NWRP Quarterly and TSS COD Weekly Samples.
- Item B29 in progress. Removed Flange and pipe section from IX Vessel #3 where leak existed.
- Fixed RO#2 Antiscalant pump discharge side fitting leak. Replaced O ring gasket in discharge fitting. RO#2 anti scalant pump is now primed. No Leaks.



Schwartzwalder Daily Summary Report 6/18/25

1 message

Bryant Acevedo <bryant.acevedo@linkan.com>

Thu, Jun 19, 2025 at 11:11 AM

To: Peter Hays - DNR <peter.hays@state.co.us>

Cc: Adam Billin <Adam.Billin@linkan.com>, Sam Billin <sam.billin@linkan.com>, Quinn Westmoreland <quinn.westmoreland@linkan.com>, Brandy Wadford <brandy.wadford@linkan.com>, Jared Buck <jared.buck@linkan.com>, Alex Schwiebert <alex.schwiebert@linkan.com>, Chris Prosper <chris.prosper@linkan.com>, Patrick Delaney <pdelaney@blackfoxmining.com>

Good morning,

See attached for 6/18/25 Summary Report and
Pictures of

- IX Vessel 3 leaking section jacked secure and staged for removal.
- Union loosened.
- Leaking Section removed with flanged valve.
- Flanged valve bolted back in its original position.

Best,

Bryant Acevedo
Operator Technician



cell: 720-238-6169

linkan.com • bryant.acevedo@linkan.com

PLEASE NOTE: This message, including any attachments, may include privileged, confidential and/or inside information. Any distribution or use of this communication by anyone other than the intended recipient is strictly prohibited and may be unlawful. If you are not the intended recipient, please notify the sender by replying to this message and then delete it from your system.

7 attachments



IMG_7697.jpeg
1052K



IMG_7699.jpeg
2554K




IMG_7700.jpeg
965K



IMG_7701.jpeg
1222K



IMG_7702.jpeg
2838K

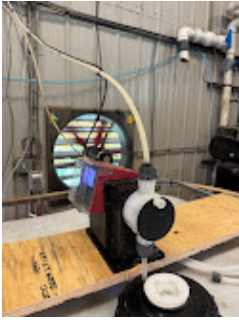

IMG_7715.jpeg
595K



SWTP Daily Summary Report 6.18.25.pdf
238K





WRT

WRTNET

VESSEL


Item B29 - Rep
There is a known lea
water treatment. The
the IX vessel #3 sys




VESSEL
#3



®

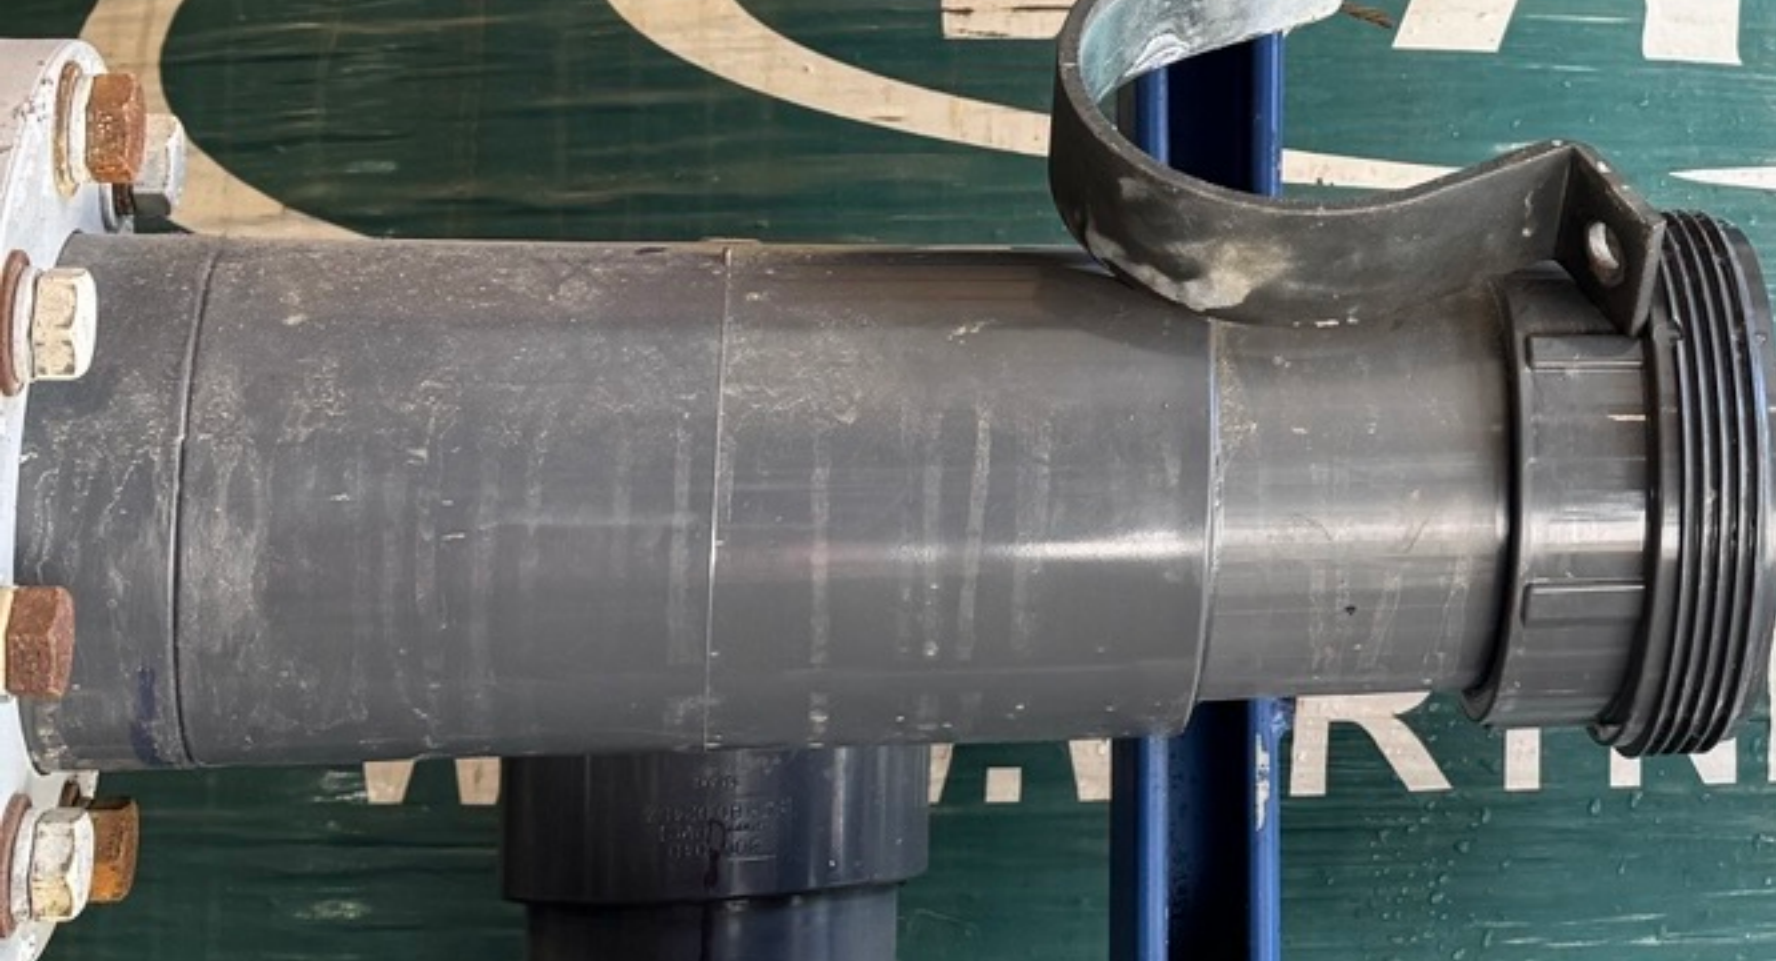





NSF-DW 320 PSI. U.P.

BOLT TORQUE 125 FT-LBS

SPARS®
8
VSA
4
PVC

SPARS®
11/2
3 1/2

P5500

®

COM

